



Geotechnical and Environmental Sciences Consultants

**PHASE I
ENVIRONMENTAL SITE ASSESSMENT REPORT
PARCEL NO. 008-261-45
TONOPAH, NEVADA**

PREPARED FOR:
Nye County
1510 East Basin Avenue, Suite 2
Pahrump, Nevada 89060

PREPARED BY:
Ninyo & Moore
Geotechnical and Environmental Sciences Consultants
6700 Paradise Road, Suite E
Las Vegas, Nevada 89119

December 11, 2009
Project No. 302967001

December 11, 2009
Project No. 302967001

Ms. Pam Webster
Assistant Nye County Manager
1510 East Basin Avenue, Suite 2
Pahrump, Nevada 89060

Subject: Phase I Environmental Site Assessment Report
Parcel No. 008-261-45
Tonopah, Nevada


Dear Ms. Webster:

In accordance with your authorization, Ninyo & Moore has performed a Phase I Environmental Site Assessment of the above-referenced site. The attached report presents our methodology, findings, opinions, and conclusions regarding the environmental conditions at the site. We appreciate the opportunity to be of service to you on this project.

Sincerely,
NINYO & MOORE



Ryan C. Jones, C.E.M.
Project Geologist

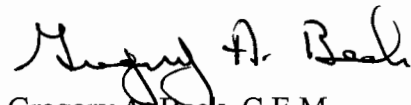

Gregory A. Beck, C.E.M.
Chief Environmental Scientist

RCJ/GB/ltk

Distribution: (2) Addressee
(1) Ms. MaryEllen Giampaoli

TABLE OF CONTENTS

	<u>Page</u>
EXECUTIVE SUMMARY	ES-1
1. INTRODUCTION	1
1.1. Purpose	1
1.2. Involved Parties	1
1.3. Detailed Scope of Services	2
1.4. Significant Assumptions	3
1.5. Limitations and Exceptions	3
1.6. Special Terms and Conditions	4
1.7. User Reliance	4
2. SITE DESCRIPTION	4
2.1. Location	4
2.2. Site and Vicinity General Characteristics	5
2.3. Current Use of the Property	5
2.4. Description of Structures, Roads, Other Improvements on the Site	5
2.4.1. Site Structures	5
2.4.2. Roads	5
2.4.3. Other Site Improvements	6
2.4.4. Heating and Cooling Systems	6
2.4.5. Sewage Disposal	6
2.4.6. Potable Water	6
2.5. Current Uses of the Adjoining Properties	6
3. USER PROVIDED INFORMATION	7
3.1. Title Records	7
3.2. Environmental Liens or Activity and Use Limitations	7
3.3. Specialized Knowledge	7
3.4. Commonly Known or Reasonably Ascertainable Information	8
3.5. Valuation Reduction for Environmental Issues	8
3.6. Owner, Property Manager, and Occupant Information	8
3.7. Reason for Performing Phase I	8
3.8. Previous Reports and Documents	8
4. RECORDS REVIEW	9
4.1. Standard Environmental Record Sources	9
4.2. Additional Environmental Record Sources	14
4.3. Physical Setting Sources	15
4.3.1. Site Topography	15
4.3.2. Site Geology	15
4.3.3. Site Hydrology	16
4.4. Historical Use Information on the Property	16
4.4.1. Historical Property Ownership	17
4.4.2. Historical Aerial Photographs	17
4.4.3. City Directories	18

4.4.4.	Fire Insurance Maps.....	18
4.4.5.	Historical Topographic Maps.....	18
4.5.	Historical Use Information on Adjoining Properties.....	18
4.5.1.	Historical Property Ownership.....	19
4.5.2.	Historical Aerial Photographs.....	19
4.5.3.	City Directories.....	20
4.5.4.	Fire Insurance Maps.....	20
4.5.5.	Historical Topographic Maps.....	20
5.	SITE RECONNAISSANCE.....	21
5.1.	Methodology and Limiting Conditions.....	21
5.2.	General Site Setting.....	21
5.3.	Exterior Observations.....	21
5.4.	Interior Observations.....	23
5.5.	Waste Management and Regulated Materials.....	23
5.6.	Storage Tanks.....	23
5.7.	Utilities.....	23
6.	INTERVIEWS.....	24
6.1.	Interview with Owner.....	24
6.2.	Interview with Local Government Officials.....	24
7.	FINDINGS, OPINIONS, AND CONCLUSIONS.....	25
7.1.	Findings and Opinions.....	25
7.2.	Conclusions.....	26
7.3.	Data Gaps and Data Failures.....	26
7.4.	Deviations.....	26
8.	ADDITIONAL SERVICES.....	26
9.	REFERENCES.....	27
10.	SIGNATURES OF ENVIRONMENTAL PROFESSIONALS.....	28
11.	QUALIFICATIONS OF ENVIRONMENTAL PROFESSIONALS.....	28

Tables

Table 1 – Summary of Environmental Database Search.....	9
Table 2 – Aerial Photographs Reviewed for the Property.....	17
Table 3 – Aerial Photograph Summary for the Property.....	17
Table 4 – Aerial Photographs Reviewed for Adjoining Properties.....	19
Table 5 – Aerial Photograph Summary for Adjoining Properties.....	19

Figures

Figure 1 – Site Location	
Figure 2 – Site Plan	

Appendices

Appendix A – Site Photographs

Appendix B – Property Records Documentation

B-1 - Nye County Tax Assessor Records

B-2 - Environmental Lien Search Report

Appendix C – Regulatory Records Documentation

Appendix D – Historical Research Documentation

D-1 - Historical Topographic Maps

D-2 - Aerial Photograph

Appendix E – Interview Documentation

E-1 - Owner Interview Documentation

E-2 - Local Governmental Officials Interview Documentation

E-3 - Other Interview Documentation

Appendix F – Environmental Professional Qualifications

EXECUTIVE SUMMARY

Ninyo & Moore was retained by Nye County to perform a Phase I Environmental Site Assessment (ESA) of approximately 5.5 acres comprised of a single, partially developed parcel of land, designated by the Nye County Tax Assessor as parcel number 008-261-45, and located on the northwest corner of the intersection of Logan Field Road and United States (U.S.) Highway 95 in Tonopah, Nye County, Nevada. Historical research, document review, and site assessment activities were conducted during the week of October 23, 2009.

In summary, the following items were noted:

- The subject site consists of a single partially developed parcel of land totaling approximately 5.5 acres in area, designated by the Nye County Tax Assessor as parcel number 008-261-45, and located on the northwest corner of the intersection of Logan Field Road and U.S. Highway 95 in Tonopah, Nye County, Nevada.
- Based on a review of historical sources the parcel constituting the subject site was developed with an ambulance bay operated by Nye County Emergency Services circa 1996 and a paved driveway associated with the western adjoining Tonopah Senior Center circa 1997. The remainder of the subject site consists of undeveloped land.
- Ninyo & Moore observed a concrete foundation pad near the center of the subject site. No information was available regarding the purpose of this foundation pad.
- General debris, including concrete, scrap metal, tires, and trash was observed on the subject site. In addition, a de minimis quantity of asphalt sealant was observed near the eastern margin of the subject site. However, these materials are not considered to represent an environmental concern for the subject site at this time.
- According to the Nye County Tax Assessor, there is no septic system on the subject site and no evidence of one was observed. However, due to the presence of a concrete foundation pad of unknown historical use, it is possible that a septic system was in use on the site in the past. Ninyo & Moore assumes that the ambulance bay is connected to the Tonopah Public Utilities sewer system.
- No drums, unidentified substance containers, or other evidence of the storage or disposal of hazardous substances or petroleum products was observed at the subject site during the site reconnaissance.
- No evidence of aboveground storage tanks (ASTs) or underground storage tanks (USTs) (i.e., fill pipes, vent pipes, and emergency power generators) was observed on the subject site. However, due to the presence of a concrete foundation pad of unknown historical use, it is possible that heating oil USTs have been used on the subject site in the past.

- Review of environmental databases indicated that there are no facilities located in the vicinity of the subject site that have handled hazardous materials or petroleum products and/or have been listed as having reported releases of hazardous materials or petroleum products.
- The lack of availability of aerial photographs of the subject site between 1940 and 1994 is considered to be a significant data gap due to the presence of an undocumented concrete foundation pad on the subject site and the historical usage of nearby properties for mining operations during that period. However, no evidence of off-site historical mining activities that may pose an environmental concern to the subject site was noted.

We have performed a Phase I ESA, in conformance with the scope and limitations of the American Society for Testing and Materials (ASTM) Practice E 1527-05, for the subject property located on parcel number 008-261-45 in Tonopah, Nevada. Any exceptions to or deletions from this practice are described in Section 1.5 of this report. This assessment has revealed no evidence of recognized environmental conditions, as defined in Section 1.1 of this report.

1. INTRODUCTION

Ninyo & Moore was retained by Nye County to perform a Phase I Environmental Site Assessment (ESA) of approximately 5.5 acres comprised of a single, partially developed parcel of land, designated by the Nye County Tax Assessor as parcel number 008-261-45, and located on the northwest corner of the intersection of Logan Field Road and United States (U.S.) Highway 95 in Tonopah, Nye County, Nevada (hereinafter referred to as the site, subject site, or subject property). The following sections discuss the purpose, the involved parties, the scope of work, and the limitations and exceptions associated with the ESA.

1.1. Purpose

In accordance with the American Society for Testing and Materials (ASTM) Standards on Environmental Site Assessments for Commercial Real Estate E 1527-05, and the Environmental Protection Agency (EPA) proposed rule for All Appropriate Inquiry (AAI) standards as set forth in Title 40 of Code of Federal Regulations (CFR) Section 312.10, the objective of the due diligence Phase I ESA was to identify recognized environmental conditions (RECs), which are defined by ASTM as “the presence or likely presence of any hazardous substance or petroleum products on a property under conditions that indicate an existing release, a past release, or a material threat of a release of any hazardous substances or petroleum products into structures on the property or into the ground, groundwater, or surface water of the property.” The work was also conducted in general accordance with EPA’s AAI standards, whose objective was to identify conditions indicative of releases and threatened releases of hazardous substances on, at, in, or to the site.

1.2. Involved Parties

Mr. Ryan Jones, of Ninyo & Moore, conducted the site reconnaissance on October 23, 2009, and performed regulatory inquiries. Mr. Gregory A. Beck, of Ninyo & Moore, performed project oversight and quality review. This Phase I ESA was conducted either by and/or under the supervision of an environmental professional as set forth in 40 CFR, Chapter I, Subchapter J, Part 312.10(b) (40 CFR §312.10[b]).

1.3. Detailed Scope of Services

Ninyo & Moore's scope of services for this Phase I ESA included the following:

- Performance of a site reconnaissance to visually and/or physically observe the interior and exterior of structures and other features on the subject site as well as visible exterior features of adjacent properties to identify areas of possibly contaminated surficial soil or surface water, improperly stored hazardous materials, possible sources of polychlorinated biphenyls (PCBs), and possible risks of contamination from activities at the site and adjacent properties.
- Review of reasonably ascertainable standard environmental record sources including federal, state, and tribal regulatory agency databases for the site and for properties located within a specified radius of the site. The purpose of this review was to evaluate possible environmental impacts to the subject site and vicinity activities. These databases list locations of known hazardous waste sites, landfills, and leaking underground storage tanks (USTs), permitted facilities that utilize USTs, and facilities that use, store, or dispose of hazardous materials and/or petroleum products.
- Review of reasonably ascertainable additional environmental record sources including local records and/or additional state or tribal records for the site and for properties located within a specified radius of the site. The purpose of this review was to evaluate possible environmental impacts to the subject site and vicinity activities. These databases list locations of known hazardous waste sites, solid waste landfills, registered storage tanks, emergency releases, contaminated public wells, facilities that use, store, or dispose of hazardous materials and/or petroleum products, public utility records, and building permits.
- Performance of an environmental lien search in accordance with Section 6.2 of ASTM Standard E 1527-05 and the United States Environmental Protection Agency's AAI rule (40 CFR Part 312 Section 312.25).
- Review of reasonably ascertainable standard physical setting sources including a current United States Geological Survey (USGS) 7.5-minute topographic map, and possibly including USGS and/or state groundwater and geology maps, and Soil Conservation Service soil maps. The purpose of this review was to note information about the geologic, hydrogeologic, hydrologic, or topographic characteristics of the subject site and vicinity.
- Review of reasonably ascertainable historical documents, including aerial photographs, historical fire insurance rate maps, city directories, and property tax files. The purpose of this review was to note any obvious uses of the subject site from the present, back to the subject sites first developed use, or back to 1940, whichever is earlier.

- Performance of interviews with present owners, operators, and occupants of the subject site as well as other knowledgeable parties as appropriate. The purpose of these interviews was to attempt to obtain information relevant to the uses and conditions of the subject site.
- Preparation of this Phase I ESA report documenting methodology; reporting findings significant data gaps, and conclusions; and providing opinions of the impact on the subject site of conditions noted in the findings section regarding recognized environmental conditions at the subject site.

This study did not include an evaluation of geotechnical conditions or potential geologic hazards. In addition, unless otherwise indicated in Section 8 of this report, this Phase I ESA does not include analysis of the following: asbestos-containing material (ACM), methane gas, radon, lead-based paint, lead in drinking water, wetlands, regulatory compliance, cultural and historical resources, industrial hygiene, health and safety, ecological resources, endangered species, indoor air quality including vapor intrusion, or high voltage power lines.

1.4. Significant Assumptions

No significant assumptions are included in this Phase I ESA.

1.5. Limitations and Exceptions

The environmental services described in this report have been conducted in general accordance with current regulatory guidelines and the standard-of-care exercised by environmental consultants performing similar work in the project area. No warranty, expressed or implied, is made regarding the professional opinions presented in this report. Please note that this study did not include an evaluation of geotechnical conditions or potential geologic hazards.

This document is intended to be used only in its entirety. No portion of the document, by itself, is designed to completely represent any aspect of the project described herein. Ninyo & Moore should be contacted if the reader requires any additional information or has questions regarding the content, interpretations presented, or completeness of this document.

Our conclusions, recommendations, and opinions are based on an analysis of the observed site conditions and the referenced literature. It should be understood that the conditions of a site could change with time as a result of natural processes or the activities of man at the subject site or nearby sites. In addition, changes to the applicable laws, regulations, codes, and standards of practice may occur due to government action or the broadening of knowledge. The findings of this report may, therefore, be invalidated over time, in part or in whole, by changes over which Ninyo & Moore has no control.

This report is intended exclusively for use by the client. Any use or reuse of the findings, conclusions, and/or recommendations of this report by parties other than the client is undertaken at said parties' sole risk.

1.6. Special Terms and Conditions

No special terms and conditions were associated with the subject site.

1.7. User Reliance

This report may be relied upon by, and is intended exclusively for, Nye County, Nevada (client or user). Any use or reuse of the findings, opinions, and/or conclusions of this report by parties other than the client is undertaken at said parties' sole risk.

2. SITE DESCRIPTION

2.1. Location

The subject site comprises approximately 5.5 acres located on the northwest corner of the intersection of Logan Field Road and U.S. Highway 95 in Tonopah, Nye County, Nevada. The subject parcel is located in Section 1, Township 2 North, Range 42 East, Tonopah Quadrangle, Nevada and has no assigned address.

A site location map is presented on Figure 1. A site map with additional information concerning the site and surrounding properties is presented on Figure 2. Select photographs taken during the site reconnaissance visits are included in Appendix A.

2.2. Site and Vicinity General Characteristics

The area in the general vicinity of, and including, the subject site consists of partially developed land, commercially developed land, municipally developed land, and residentially developed land.

2.3. Current Use of the Property

The subject site, designated by the Nye County Tax Assessor as parcel number 008-261-45, is partially developed land with sparse desert vegetation, an ambulance bay operated by Nye County Emergency Services, a paved driveway associated with the western adjoining Tonopah Senior Center, and a land use code of "400 - General Commercial - retail, mixed, schools, hospitals, gas stations, etc." A copy of the Nye County Tax Assessor parcel information is included in Appendix B-1.

2.4. Description of Structures, Roads, Other Improvements on the Site

The following paragraphs present a description of the structures present at the subject site, roads, other improvements on the subject site (including heating/cooling, sewage disposal, and potable water systems).

2.4.1. Site Structures

The subject site is developed with an ambulance bay operated by Nye County Emergency Services and located near the western margin of the subject site. A concrete foundation pad was observed near the center of the subject site. No information was available concerning the presence of this foundation pad.

2.4.2. Roads

Paved U.S. Highway 95 and Logan Field Road border the subject site to the north and east, respectively. A paved driveway crosses the southwest corner of the subject site and connects the western adjoining Tonopah Senior Center with Logan Field Road. Two unpaved driveways are located near the northern margin and center of the subject site.

2.4.3. Other Site Improvements

A vertical control mark was observed near the southeast portion of the subject site and a drainage ditch was observed along the northern margin. An electrical box and pole-mounted electrical lines were observed on the western portion of the subject site. No other site improvements were noted on the subject site.

2.4.4. Heating and Cooling Systems

A pad-mounted air conditioning unit was observed to the south of the ambulance bay. According to the Nye County Tax Assessor, the ambulance bay uses a heat pump. Due to the presence of a concrete foundation pad of unknown historical use, it is possible that heating oil USTs have been used on the subject site in the past. However, no evidence of USTs was found on the subject site.

2.4.5. Sewage Disposal

According to the Nye County Tax Assessor, there is no septic system located on the subject site and no evidence of one was observed on the subject site. However, due to the presence of a concrete foundation pad of unknown historical use, it is possible that a septic system was in use on the site in the past. Ninyo & Moore assumes that the ambulance bay is connected to the Tonopah Public Utilities sewer system.

2.4.6. Potable Water

Ninyo & Moore assumes that the ambulance bay is connected to the municipal water distribution network. In addition, Ninyo & Moore observed a possible water valve associated with the concrete foundation pad. Based on the historical usage of the site and observation of the possible water valve, it may have been connected to a municipal water distribution network at one time.

2.5. Current Uses of the Adjoining Properties

The subject property is bordered to the north by the Nye Regional Medical Center (parcel 008-261-44); to the northeast and east by U.S. Highway 95, across which is residentially

developed land (parcel numbers 008-28-101 through 008-28-106); to the southeast by Logan Field Road, across which is the Central Nevada Museum (parcels 008-261-15 and 008-261-16); to the south by a municipal football field owned by the Nye County School Corporation (parcel 008-261-25); and to the west by the Nevada Department of Transportation (parcel 008-261-08), Nye Regional Medical Center (parcel 008-261-44), and the Tonopah Senior Center (parcel 008-261-11).

No information was found to suggest that the current uses of adjoining properties involve the use, treatment, storage, disposal or generation of hazardous substances or petroleum products that may represent an environmental concern to the subject site at this time.

3. USER PROVIDED INFORMATION

3.1. Title Records

No title report was provided by the client for purposes of this assessment.

3.2. Environmental Liens or Activity and Use Limitations

Ninyo & Moore conducted an environmental lien search to fulfill the user's responsibilities with regard to review of environmental liens as described in Section 6.2 of ASTM Practice E 1527-05. The environmental lien search was performed by FirstSearch Technology Corporation. The environmental lien search report, dated November 11, 2009, found no environmental liens associated with the subject site. A copy of the environmental lien search is provided as Appendix B-2.

3.3. Specialized Knowledge

Ms. Eileen Christensen, the client contact representative, provided site location and background information. No specialized knowledge or experience pertaining to recognized environmental conditions on the subject site was communicated to Ninyo & Moore during interview or noted during file reviews during the course of this ESA.

3.4. Commonly Known or Reasonably Ascertainable Information

No commonly known or reasonably ascertainable information within the community material to recognized environmental conditions pertaining to the subject site was noted by Ninyo & Moore or communicated to us in writing, in person, or during telephone conversations in the course of this assessment.

3.5. Valuation Reduction for Environmental Issues

This Phase I ESA is being conducted in association with the Nye County Brownfields assessment program for property owned by Nye County. According to information provided by Ms. Christensen, on behalf of the client contact, Ms. Pamela Webster of Nye County, the subject parcel is expected to be included in a land swap for a parcel or parcels of equal value.

3.6. Owner, Property Manager, and Occupant Information

The subject site is owned by the Nye County Commissioners at P.O. Box 153, Tonopah, Nevada, 89049-0473. The subject site is partially developed and occupied by an ambulance bay used by Nye County Emergency Services.

3.7. Reason for Performing Phase I

Ms. Christensen indicated that this Phase I ESA was being performed as part of the Brownfields area inventory and ranking process through the Nye County Brownfields program.

3.8. Previous Reports and Documents

No reports were provided for the purposes of this assessment.

4. RECORDS REVIEW

4.1. Standard Environmental Record Sources

A computerized environmental information database search was performed by *Environmental FirstSearch™* (*FirstSearch™*) dated October 28, 2009. The *FirstSearch™* report included federal, state, and local databases. A summary of the environmental databases searched, their corresponding search radii, and number of noted sites of environmental concern, is presented in Table 1. In addition, the *FirstSearch™* report and a description of the assumptions and approaches to the database search are presented in Appendix C.

Table 1 – Summary of Environmental Database Search

Database Name	Agency	Search Radius (miles)	Sites Listed
Federal Records			
National Priority List (NPL)	USEPA	1.00	0
Delisted NPL	USEPA	0.50	0
Sites currently or formerly under review by US EPA (CERCLIS)	USEPA	0.50	0
No Further Remedial Activities Planned (NFRAP)	USEPA	0.50	0
RCRA Corrective Action w/o TSD (CORRACTS)	USEPA	1.00	0
RCRA Treatment, Storage, and Disposal (TSD) Facilities	USEPA	0.50	0
RCRA Large/Small Quantity Generators List (LQ/SQ-GEN)	USEPA	0.25	0
RCRA NLR	USEPA	0.12	0
Federal Engineering and Institutional Controls (IC/EC)	USEPA	0.25	0
Emergency Response Notification System (ERNS) List	NRC	0.12	0
State and Local Records			
State Sites	NDEP	1.00	0
Permitted as solid waste landfills, incinerators, or transfer stations (SWL)	NDEP	0.50	0
Leaking Underground Storage Tank (LUST) Lists	NDEP	0.50	0
Registered UST/Aboveground Storage Tank (AST) List	NDEP	0.25	0
Voluntary Cleanup Program Sites (VCP)	NDEP	0.50	0
Project Tracking Database State (Brownfields)	NDEP	0.50	0
State Engineering and Institutional Controls (IC/EC)	NDEP	0.25	0
Tribal Records			
Tribal Lands	BIA	1.00	0
Indian LUST	NDEP	0.50	0
Indian UST/AST	EPA Region 9	0.25	0
BIA - Bureau of Indian Affairs NDEP - Nevada Division of Environmental Protection NRC - National Response Center USEPA - United States Environmental Protection Agency			

The review was conducted to evaluate whether or not the subject site or properties within the vicinity of the subject site have been listed as having experienced significant unauthorized releases of hazardous substances or other events with potentially adverse environmental effects.

The following paragraphs describe the databases that were searched for properties of environmental concern, and include a discussion of the regulatory status of the facilities and potential environmental impact to the subject site (if applicable). The groundwater gradient information provided indicates whether the individual facility is assumed to be upgradient, downgradient, or crossgradient from the subject site in terms of groundwater flow.

United States Environmental Protection Agency, National Priorities List (NPL)

This list identifies hazardous material sites slated for cleanup under the federally sponsored Superfund program. These sites receive remedial funding under Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). No facilities were listed within a 1-mile radius of the subject site.

United States Environmental Protection Agency, Delisted NPL

This list identifies hazardous material sites deleted from the NPL. The National Oil and Hazardous Substances Pollution Contingency Plan establishes the criteria that USEPA uses to delete sites from the NPL. In accordance with 40 CFR §300.425(e), sites may be deleted from the NPL where no further response is appropriate. No facilities were listed within a 1-mile radius of the subject site.

United States Environmental Protection Agency, CERCLIS List

This list identifies hazardous material sites or environmental incidents recognized and listed on the federal level. Facilities identified by the United States Environmental Protection Agency (USEPA), which may have the potential for releasing hazardous substances into the environment, are listed in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) database. No facilities were listed within a 0.5-mile radius of the subject site.

United States Environmental Protection Agency, NFRAP List

This archive list identifies, to the best of USEPA's knowledge, facilities where assessment has been completed and EPA has determined no further steps will be taken to list this facility on the NPL. This decision does not necessarily mean that there is no hazard associated with the facility; it merely means that, based upon available information, the location is not judged a potential NPL site. No facilities were listed within a 0.5-mile radius of the subject site.

United States Environmental Protection Agency, CORRACTS List

This list identifies RCRA facilities that are undergoing "corrective action." A "corrective action order" is issued pursuant to RCRA when there has been a release of hazardous waste into the environment from a RCRA facility. No facilities were listed within a 1-mile radius of the subject site.

United States Environmental Protection Agency, RCRA TSD List

This list identifies USEPA-listed facilities that report storage, treatment, and/or disposal of hazardous waste (i.e., TSD facility) under the USEPA Resource Conservation and Recovery Act (RCRA) program. No facilities were listed within a 0.5-mile radius of the subject site.

United States Environmental Protection Agency, RCRA Large-Quantity and Small Quantity Generator (GEN)

This database identifies USEPA-listed facilities that report generation of reportable quantities of hazardous waste under the RCRA program for the identification and tracking of hazardous waste. The list consists of properties that generate more than 1,000 kilograms (kg) of hazardous waste per month (large quantity generators) and properties that generate less than 1,000 kg of hazardous waste per month (small quantity generators), and is not necessarily indicative of facilities where a release of hazardous substances has occurred. No facilities were listed within a 0.25-mile radius of the subject site.

United States Environmental Protection Agency – RCRA No Longer Regulated (NLR)

This database identifies USEPA-listed facilities that report generation of less than 100 kg of hazardous waste under the RCRA program for the identification and tracking of hazardous waste or do not meet other RCRA requirements. No facilities were listed within a 0.12-mile radius of the subject site.

United States Environmental Protection Agency – US Engineering Controls

A listing of facilities with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health. The subject site was not listed on this database.

United States Environmental Protection Agency – US Institutional Controls

A listing of facilities with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls. The subject site was not listed on this database.

United States Environmental Protection Agency – Emergency Response Notification System (ERNS)

The ERNS is a national database used to collect information on reported releases of oil and hazardous substances. The database contains information from spill reports made to federal authorities, including the USEPA, the United States Coast Guard, the National Response Center, and the Department of Transportation (DOT). The subject site was not listed on this database.

Nevada Department of Conservation and Natural Resources, Corrective Action Cases (State Sites)

The Nevada Department of Conservation and Natural Resources, Bureau of Corrective Actions maintains a list of cleanup evaluations and actions regarding sites with actual or potential contamination that could affect groundwater. No facilities were listed within a 1-mile radius of the subject site.

Nevada Department of Conservation and Natural Resources, Landfill List

The Nevada Department of Conservation and Natural Resources maintains lists of facilities including active solid waste disposal sites, inactive or closed solid waste disposal sites, and transfer facilities. No facilities were listed within a 0.5-mile radius of the subject site.

Nevada Department of Conservation and Natural Resources, Leaking Underground Storage Tank (LUST) List

The LUST Information System is maintained by the Nevada Department of Conservation and Natural Resources. It includes sites with tanks under investigation, for potential leaks, confirmed leaks, and those to be closed. No facilities were listed within a 0.5-mile radius of the subject site.

Nevada Department of Conservation and Natural Resources, Underground Storage Tank (UST) and Aboveground Storage Tank (AST) Lists

Information regarding USTs and aboveground storage tanks (ASTs) registered with the Nevada Department of Conservation and Natural Resources is provided on the agency's UST list and AST list. The UST and AST lists consist of properties that have registered tanks, and are not necessarily indicative of sites where a release of hazardous substances has occurred. No facilities were listed within a 0.25-mile radius of the subject site.

Nevada Department of Conservation and Natural Resources - State Engineering Controls

A listing of facilities with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health. The subject site was not listed on this database.

Nevada Department of Conservation and Natural Resources - State Institutional Controls

A listing of facilities with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls. The subject site was not listed on this database

Nevada Division of Environmental Protection, Voluntary Cleanup Program Sites (VCP)

The Voluntary Cleanup Program provides relief from liability to owners who undertake cleanups of contaminated properties under the oversight of the Nevada Division of

Environmental Protection (NDEP). No facilities were listed within a 0.5-mile radius of the subject site.

Nevada Department of Conservation and Natural Resources, Project Tracking Database (Brownfields)

Brownfields sites included in the Project Tracking Database. The term "Brownfields" is used to describe abandoned, idled, or underused industrial or commercial properties taken out of productive use because of real or perceived risks from environmental contamination. The State of Nevada has initiated Brownfields, a land-recycling program, to provide an opportunity to redevelop these undesirable properties and revitalize communities. No facilities were listed within a 0.5-mile radius of the subject site.

United States Geological Survey, Indian Reservations (INDIAN RESERV)

Indian administered lands of the United States that have any area equal to or greater than 640 acres. No facilities were listed within a 1-mile radius of the subject site.

United States Environmental Protection Agency, Leaking Underground Storage Tanks on Indian land (INDIAN LUST R9)

LUSTs on Indian land in Arizona, California, New Mexico, and Nevada. No facilities were listed within a 0.5-mile radius of the subject site.

United States Environmental Protection Agency, Underground Storage Tanks on Indian land (INDIAN UST R9)

USTs on Indian land in Arizona, California, New Mexico, and Nevada. No facilities were listed within a 0.25-mile radius of the subject site.

4.2. Additional Environmental Record Sources

Ninyo & Moore reviewed NDEP records on the Bureau of Corrective Actions (BCA) Download Database. Records including UST lists organized by facility number, owner information, and facility addresses were reviewed for facilities located in the site vicinity zip code(s). In addition, the list of corrective action and LUST sites as compiled by NDEP-BCA were reviewed for facilities located in the site vicinity zip code(s). No facilities were noted.

Ninyo & Moore reviewed USEPA records on the Enforcement and Compliance History Online (ECHO) Database. Records including RCRA generators were reviewed for facilities located in the site vicinity zip code. In addition, facilities with compliance violations were reviewed for the site vicinity zip code(s). No sites were listed within the site vicinity zip code.

4.3. Physical Setting Sources

The following sections include discussions of topographic, geologic, and hydrogeologic conditions in the vicinity of the site, based upon our document review and our visual reconnaissance of the site and adjacent areas.

4.3.1. Site Topography

The USGS Tonopah Quadrangle, Nevada, 7.5-minute series topographic map, dated 1960 (photorevised 1982), shows the site to be at an elevation of approximately 6,150 feet above mean sea level with drainage of the site toward the northeast. A copy of the topographic map is included in Appendix D-1.

4.3.2. Site Geology

Tonopah is located in northwestern Nye County, which lies near the center of the Great Basin section of the Basin and Range physiographic province. Within this section, sub parallel north-trending elongate mountain ranges rise abruptly from and are separated by broad intermountain valleys.

Tonopah is located at the southern end of the San Antonio Mountains, most of which lie within northern Nye County that are about 30 miles in length and as much as 13 miles wide. Summit elevations at the north end of the range are greater than 8,000 feet but diminish southward to between 6,000 to 7,000 feet above mean sea level.

Deformed and altered Tertiary volcanic rocks crop out beneath the Fraction Tuff near Tonopah and locally along the west side of the San Antonio range. The Fraction Tuff is classed as a rhyolitic unit. The volcanic rocks at Tonopah are distinctive and include the

Mizpah Trachyte, Siebert Tuff, and Oddie Rhyolite. The Siebert Tuff in the Tonopah area inter-tongues extensively with basaltic rocks. The Mizpah Trachyte was the principal ore-bearing formation at Tonopah.

The subject site is located near several mountains with ephemeral washes that carry sediments to alluvial fan deposits on the mountain flanks. These alluvial fan deposits consisting of mixtures of gravelly sand and silty sand underlie the subject site. As the distance increases from the source rock area, the sediments carried down to the alluvial fans become increasingly finer grained.

4.3.3. Site Hydrology

The following sections discuss the site hydrology in terms of both surface waters and groundwater.

4.3.3.1. Surface Waters

No natural surface water bodies, including ponds, streams, or other bodies of water, are present on the site.

4.3.3.2. Groundwater

Review of the Nevada Division of Water Resources well log database indicated that no well logs or static water level records were available for the subject site or vicinity. Based on topography, groundwater flow direction in the vicinity of the subject property is believed to be toward the northeast.

4.4. Historical Use Information on the Property

Ninyo & Moore conducted a historical record search for the subject site. This included a review of one or more of the following resources that were found to be both reasonably ascertainable and useful for the purposes of this Phase I ESA: historical aerial photographs, historical fire insurance maps, historical topographic maps, land use records, interviews with property representatives, and reviews of prior environmental assessment reports regarding

the site. The following sections summarize information obtained from the historical sources utilized for this assessment.

4.4.1. Historical Property Ownership

Although a title search was not included in the scope of work for the subject site, historical property ownership records were reviewed on the website of the Nye County Tax Assessor. No ownership entries of environmental concern were noted in the record.

4.4.2. Historical Aerial Photographs

Selected historical aerial photographs dating from between 1994 and 2008 were available and reviewed for the subject site. Aerial photographs prior to 1994 were not readily available. The lack of availability of aerial photographs between 1940 and 1994 may be a significant data gap due to the presence of an undocumented concrete foundation pad of unknown historical use. A listing of the photographs reviewed is presented in Table 2. Table 3 summarizes notable observations from each photograph. A copy of the 2008 aerial photograph of the subject site and vicinity is included in Appendix D-2.

Table 2 – Aerial Photographs Reviewed for the Property

Date	Photograph Identification	Scale	Source
1994	Website	Unknown	A
2006	Website	1:2,400	B
2008	Unknown	Unknown	C
Sources: A – Terraserver-USA Website B – Historical Aerials Website C – Google Earth			

Table 3 – Aerial Photograph Summary for the Property

Year	Aerial Photograph Description
1994	A concrete pad is evident near the center of the subject site, with a structure (ambulance bay) evident near the western portion of the subject site. A drainage ditch is evident along the western edge of U.S. Highway 95. Unpaved driveways are evident near the northern margin and center of the subject site. The remainder of the subject site is evident as undeveloped land.
2006	A paved driveway is evident near the southwest corner of the subject site. Graded, vacant land is evident near the southwest corner of the subject site.
2008	No significant changes from the 2006 photograph.

4.4.3. City Directories

There was no city directory coverage for the subject site. The lack of city directory coverage for the subject site from 1940 to the present is not considered a significant data failure due to the historical usage of the subject site and the availability of other historical resources (e.g. topographic maps and aerial photographs).

4.4.4. Fire Insurance Maps

There was no Sanborn fire insurance map coverage for the subject site. This is not considered a significant data failure due to the availability of other historical resources (e.g. topographic maps and aerial photographs).

4.4.5. Historical Topographic Maps

The USGS Tonopah Quadrangle, Nevada, 15-minute series topographic map, dated 1961, depicts the site as undeveloped land. No items of potential environmental concern for the subject site were noted on this topographic map.

The USGS Tonopah Quadrangle, Nevada, 7.5-minute series topographic map, dated 1960 (photorevised 1982) depicts the subject site as undeveloped land. No items of potential environmental concern for the subject site were noted on this topographic map. Copies of the historical topographic maps are provided in Appendix D-1.

4.5. Historical Use Information on Adjoining Properties

Ninyo & Moore conducted a historical record search for the adjoining properties. This included a review of one or more of the following sources found to be both reasonably ascertainable and useful for the purposes of this Phase I ESA: historical aerial photographs, historical fire insurance maps, historical topographic maps, land use records, interviews with property representatives, and reviews of prior environmental assessment reports regarding neighboring properties. The following sections summarize information obtained from the historical sources utilized for this assessment.

4.5.1. Historical Property Ownership

Although a title search was not included in the scope of work for the site vicinity, historical property ownership records for adjoining properties were reviewed on the website of the Nye County Tax Assessor. No ownership entries of environmental concern were noted in the record.

4.5.2. Historical Aerial Photographs

Selected historical aerial photographs dating from between 1994 and 2008 were available and reviewed for the subject site vicinity. Aerial photographs prior to 1994 were not readily available. The lack of availability of aerial photographs prior to 1994 is considered to be a significant data failure due to historical usage of the surrounding property for mining operations during that period. A listing of the photographs reviewed is presented in Table 4. Table 5 summarizes notable observations from each photograph. A copy of the 2008 aerial photograph of the subject site and vicinity is included in Appendix D-2.

Table 4 – Aerial Photographs Reviewed for Adjoining Properties

Date	Photograph Identification	Scale	Source
1994	Website	Unknown	A
2006	Website	1:2,400	B
2008	Unknown	Unknown	C
Sources: A – Terraserver-USA Website B – Historical Aerials Website C – Google Earth			

Table 5 – Aerial Photograph Summary for Adjoining Properties

Year	Aerial Photograph Description
1994	U.S. Highway 95 is evident to the north of the subject site as a paved road, across which is residential development. Logan Field Road is evident as an unpaved road to the east of the subject site, across which are two structures (Central Nevada Museum). A football field is evident to the south of the subject site. Partially graded land and six structures belonging to the Nevada Department of Transportation (NDOT) and the Nye Regional Medical Center are evident to the west of the subject site.
2006	Additional NDOT development is evident to the west of the subject site. The Tonopah Senior Center and associated parking lot is evident to the west of the subject site.
2008	No significant changes from the 2006 photograph.

4.5.3. City Directories

There was no city directory coverage for the subject site vicinity. The lack of city directory coverage for the subject site vicinity from 1940 to the present is not considered a significant data failure due to the availability of other historical resources (e.g. topographic maps and aerial photographs).

4.5.4. Fire Insurance Maps

There was no Sanborn fire insurance map coverage for the subject site vicinity. This is not considered a significant data failure due to the availability of other historical resources (e.g. topographic maps and aerial photographs).

4.5.5. Historical Topographic Maps

The USGS Tonopah Quadrangle, Nevada, 15-minute series topographic map, dated 1961, depicts the site vicinity as a mix of developed and undeveloped land. U.S. Highway 95 is evident as a paved highway to the north of the subject site. Residential development is evident to the south of the subject site. Isolated prospect sites are evident to the north, east, and south of the subject site. No items of potential environmental concern for the subject site were noted in the vicinity of the subject site on this topographic map.

The USGS Tonopah Quadrangle, Nevada, 7.5-minute series topographic map, dated 1960 (photorevised 1982), depicts the site vicinity as a mix of residentially developed, commercially developed, and undeveloped land. U.S. Highway 95 and residential development are evident to the north of the subject site. Logan Field Road is evident to the east of the subject site. Commercial development is evident to the west of the subject site and a football field is evident to the south of the subject site. Isolated prospect sites are evident to the north, east, and south of the subject site. No items of potential environmental concern for the site and vicinity were noted on this topographic map. Copies of the historical topographic maps are provided in Appendix D-1.

5. SITE RECONNAISSANCE

5.1. Methodology and Limiting Conditions

On October 23, 2009, Mr. Ryan Jones, of Ninyo & Moore, conducted a site reconnaissance of the subject property. The reconnaissance involved a walking tour of the site and visual observations of adjoining properties.

During the site reconnaissance visit, Ninyo & Moore inspected the subject site for evidence suggesting the use, treatment, storage, disposal, or generation of hazardous substances or petroleum products on the subject site. Ninyo & Moore observed no such evidence.

5.2. General Site Setting

The subject site is comprised of partially developed land with sparse desert vegetation occupied by an ambulance bay and a paved driveway, totaling approximately 5.5 acres. The subject property is bordered by commercial, municipal, and residential land.

5.3. Exterior Observations

The subject property was traversed and was observed from adjacent public thoroughfares.

Easements

The environmental lien search report did not indicate that there were any easements associated with the subject site.

Pits, Ponds, or Lagoons

No pits, ponds, or lagoons were observed on the subject site.

Stained Soil or Pavement

No stained soil was observed on the subject site. A concrete foundation pad was observed near the center of the subject site. No staining was observed on the pad and no information was available regarding the purpose of this foundation pad.

Stressed Vegetation

No stressed vegetation was observed on the subject site.

Solid Waste

General debris, including concrete, scrap metal, tires, and trash was observed on the subject site. In addition, a de minimis quantity of asphalt sealant was observed near the eastern margin of the subject site. However, these materials are not considered to be environmental concerns for the subject site at this time.

Wastewater

There were no sources of wastewater observed on the subject site.

Wells

No water supply or groundwater monitoring wells were observed on the subject site.

Septic Systems

According to the Nye County Tax Assessor, there is no septic system located on the subject site and no evidence of one was observed. However, due to the presence of a concrete foundation pad of unknown historical use, it is possible that a septic system was in use on the site in the past. Ninyo & Moore assumes that the ambulance bay is connected to the Tonopah Public Utilities sewer system.

Odors

No odors were noted on the subject site.

Pools of Liquid

No exterior pools of liquid were observed on the subject site.

Drums

No drums were observed on the subject site.

Hazardous Substance and Petroleum Containers

No hazardous substance or petroleum containers were observed on the subject site.

Unidentified Substance Containers

No unidentified substance containers were observed on the subject site.

Polychlorinated Biphenyls (PCBs)

Polychlorinated biphenyls are known hazardous materials that are found in coolants or lubricating oil used in some electrical transformers, hydraulic elevators, light ballasts,

electrical panels, or other equipment. Utility companies, including Sierra Pacific Power Company (SPPC) often own transformer equipment and typically assume responsibility for repair or replacement of damaged or leaking units and for required cleanup or remediation activities. Indications of damage or leakage should be immediately reported to SPPC.

Two pole-mounted electrical transformers were observed near the southeast corner and western margin of the subject site. No evidence of leaks or staining was observed in the vicinity of the transformers.

5.4. Interior Observations

An ambulance bay operated by Nye County Emergency Services is located near the western margin of the subject site. According to the Nye County Tax Assessor, the building was constructed in 1996. Ninyo & Moore did not have access to the interior of the ambulance bay. However, based on information provided by Mr. Charlie Mann, Administrator for Nye Regional Medical Center, the lack of access to the interior of the ambulance bay is not considered to be a significant data failure.

5.5. Waste Management and Regulated Materials

No regulated materials were noted on the subject site.

5.6. Storage Tanks

No evidence of ASTs or USTs (i.e., fill pipes, vent pipes, and emergency power generators) was observed on the subject site. However, due to the presence of a concrete foundation pad of unknown historical use, it is possible that heating oil USTs with no surface expression have been used on the subject site in the past.

5.7. Utilities

SPPC supplies electrical service to the site vicinity, including the ambulance bay. Since no natural gas service is available in Tonopah, propane ASTs provided by either AmeriGas or

Suburban Propane are utilized for gas service. The Town of Tonopah Public Utilities department provides municipal potable water and sanitary sewer to the site vicinity.

6. INTERVIEWS

Interviews with present owners, operators, and/or occupants of the subject site, as well as other knowledgeable parties as appropriate, is mandated by ASTM Practice 1527-05. The objective of the interviews is to obtain information indicating recognized environmental conditions in connection with the subject site.

6.1. Interview with Owner

Ninyo & Moore requested that Mr. James Eason, the Tonopah Town Manager complete the owner questionnaire. The questionnaire completed by Mr. Eason is provided as Appendix E-1. Mr. Eason was unaware of any present or historical environmental concerns at the subject site. However, he did indicate that the subject site had been used as a “staging area” for parked cars.

6.2. Interview with Local Government Officials

The NDEP and the Nevada State Fire Marshall require a physical address to request and review files. The subject site has no assigned physical address, therefore, no files were available for review. The regulatory response from NDEP is provided in Appendix E-2.

6.3. Interview with Others

Mr. Charlie Mann, Administrator of the Nye Regional Medical Center, was interviewed by telephone regarding operations at the ambulance bay located on the subject site. According to Mr. Mann, the building is used for classroom training and to house ambulances. Mr. Mann stated that no vehicle maintenance is performed in the building and no hazardous materials other than possible retail-sized quantities of common cleaning and lubrication materials are stored there. Documentation of the telephone interview with Mr. Mann is provided as Appendix E-3.

7. FINDINGS, OPINIONS, AND CONCLUSIONS

Based upon the results of this Phase I ESA, the following findings, opinions, and conclusions are provided.

7.1. Findings and Opinions

- The subject site consists of a single partially developed parcel of land totaling approximately 5.5 acres in area, designated by the Nye County Tax Assessor as parcel number 008-261-45, and located on the northwest corner of the intersection of Logan Field Road and U.S. Highway 95 in Tonopah, Nye County, Nevada.
- Based on a review of historical sources the parcel constituting the subject site was developed with an ambulance bay operated by Nye County Emergency Services circa 1996 and a paved driveway associated with the western adjoining Tonopah Senior Center circa 1997. The remainder of the subject site consists of undeveloped land.
- Ninyo & Moore observed a concrete foundation pad near the center of the subject site. No information was available regarding the purpose of this foundation pad.
- General debris, including concrete, scrap metal, tires, and trash was observed on the subject site. In addition, a de minimis quantity of asphalt sealant was observed near the eastern margin of the subject site. However, these materials are not considered to represent an environmental concern for the subject site at this time.
- According to the Nye County Tax Assessor, there is no septic system on the subject site and no evidence of one was observed. However, due to the presence of a concrete foundation pad of unknown historical use, it is possible that a septic system was in use on the site in the past. Ninyo & Moore assumes that the ambulance bay is connected to the Tonopah Public Utilities sewer system.
- No drums, unidentified substance containers, or other evidence of the storage or disposal of hazardous substances or petroleum products was observed at the subject site during the site reconnaissance.
- No evidence of ASTs or USTs (i.e., fill pipes, vent pipes, and emergency power generators) was observed on the subject site. However, due to the presence of a concrete foundation pad of unknown historical use, it is possible that heating oil USTs have been used on the subject site in the past.
- Review of environmental databases indicated that there are no facilities located in the vicinity of the subject site that have handled hazardous materials or petroleum products and/or have been listed as having reported releases of hazardous materials or petroleum products.

7.2. Conclusions

This Phase I ESA was performed in conformance with the scope and limitations of the American Society for Testing and Materials Practice E 1527-05. Any exceptions to or deletions from this practice are described in Section 1.5 of this report. This assessment has revealed no evidence of recognized environmental conditions, as defined in Section 1.1 of this report.

7.3. Data Gaps and Data Failures

The following data gap was encountered during performance of this ESA.

- Aerial photographs for the subject site and vicinity from between 1940 and 1994 were not reasonably ascertainable. This is considered to be a significant data gap due to the presence of a concrete foundation pad of unknown historical use on the subject site and the historical usage of nearby properties for mining operations during that period. However, no evidence of off-site historical mining activities that may pose an environmental concern to the subject site was noted.

The following data failures were encountered during performance of this ESA.

- No Sanborn fire insurance map coverage was available for the subject site and vicinity. This is not considered a significant data failure due to the availability of other historical resources (e.g. topographic maps and aerial photographs).
- Cross directories were not available for the subject site and vicinity. The lack of cross directories is not considered a significant data failure due to the availability of other historical resources (e.g. topographic maps and aerial photographs).
- Ninyo & Moore did not gain access to the interior of the ambulance bay located on the subject site. However, based on information provided by Mr. Mann of Nye Regional Medical Center, the lack of access to the interior of the ambulance bay is not considered to be a significant data failure.

7.4. Deviations

No deviations from the ASTM Practice E 1527-05 and EPA's AAI standards as set forth in § 312.10 of CFR Chapter 40 Section 312 were noted during the preparation of this report.


8. ADDITIONAL SERVICES

No additional services were performed during the preparation of this report.

9. REFERENCES

- ASTM International, 2005, Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process, Designation E-1527-05.
- FirstSearch Technology Corporation, 2009, Environmental Lien Report, APN 008-261-45, Tonopah, NV 89049, dated November 11, 2009.
- Environmental FirstSearch™ Report dated October 28, 2009.
- Nevada Division of Water Resources, 2009, Online Well Log Database.
- Nye County Assessor, 2009, Online Property Information Search.
- United States Environmental Protection Agency, 2006, Innocent Landowner, Standards for Conducting All Appropriate Inquiries, 40 CFR Part 312.
- United States Environmental Protection Agency, 2006, Enforcement and Compliance Online.
- United States Geological Survey, 1961, Tonopah Quadrangle, Nevada, 15-minute series topographic map, Scale 1:62,500.
- United States Geological Survey, 1960 (photorevised 1982), Tonopah Quadrangle, Nevada, 7.5-minute series topographic map, Scale 1:24,000.

10. SIGNATURES OF ENVIRONMENTAL PROFESSIONALS


Ryan C. Jones, C.E.M.
Project Geologist


Gregory A. Beck, C.E.M.
Chief Environmental Scientist


11. QUALIFICATIONS OF ENVIRONMENTAL PROFESSIONALS

As required by 40 CFR §312.21(d) the following statement is included:

I declare that, to the best of my professional knowledge and belief, I meet the definition of Environmental Professional as defined by §312.10 of 40 CFR 312. I have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property. I have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

In accordance with the Nevada Revised Statutes 459.500, Section 1, a holder of a certificate who is responsible for a service requiring certification shall ensure that each document relating to the service includes the following language:

I, Ryan C. Jones, hereby certify that I am responsible for the services described in this document and for the preparation of this document. The services described in this document have been provided in a manner consistent with the current standards of the profession and to the best of my knowledge comply with all applicable federal, state, and local statutes, regulations, and ordinances.





Ryan C. Jones, C.E.M.
Certified Environmental Manager
No. 2129
Expires: October 18, 2011

12-11-09

Date

Resumes, which document the professional qualifications, pursuant to 40 CFR §312.10(b)(2), of the persons that prepared and reviewed this report are provided as Appendix F.

FIGURES

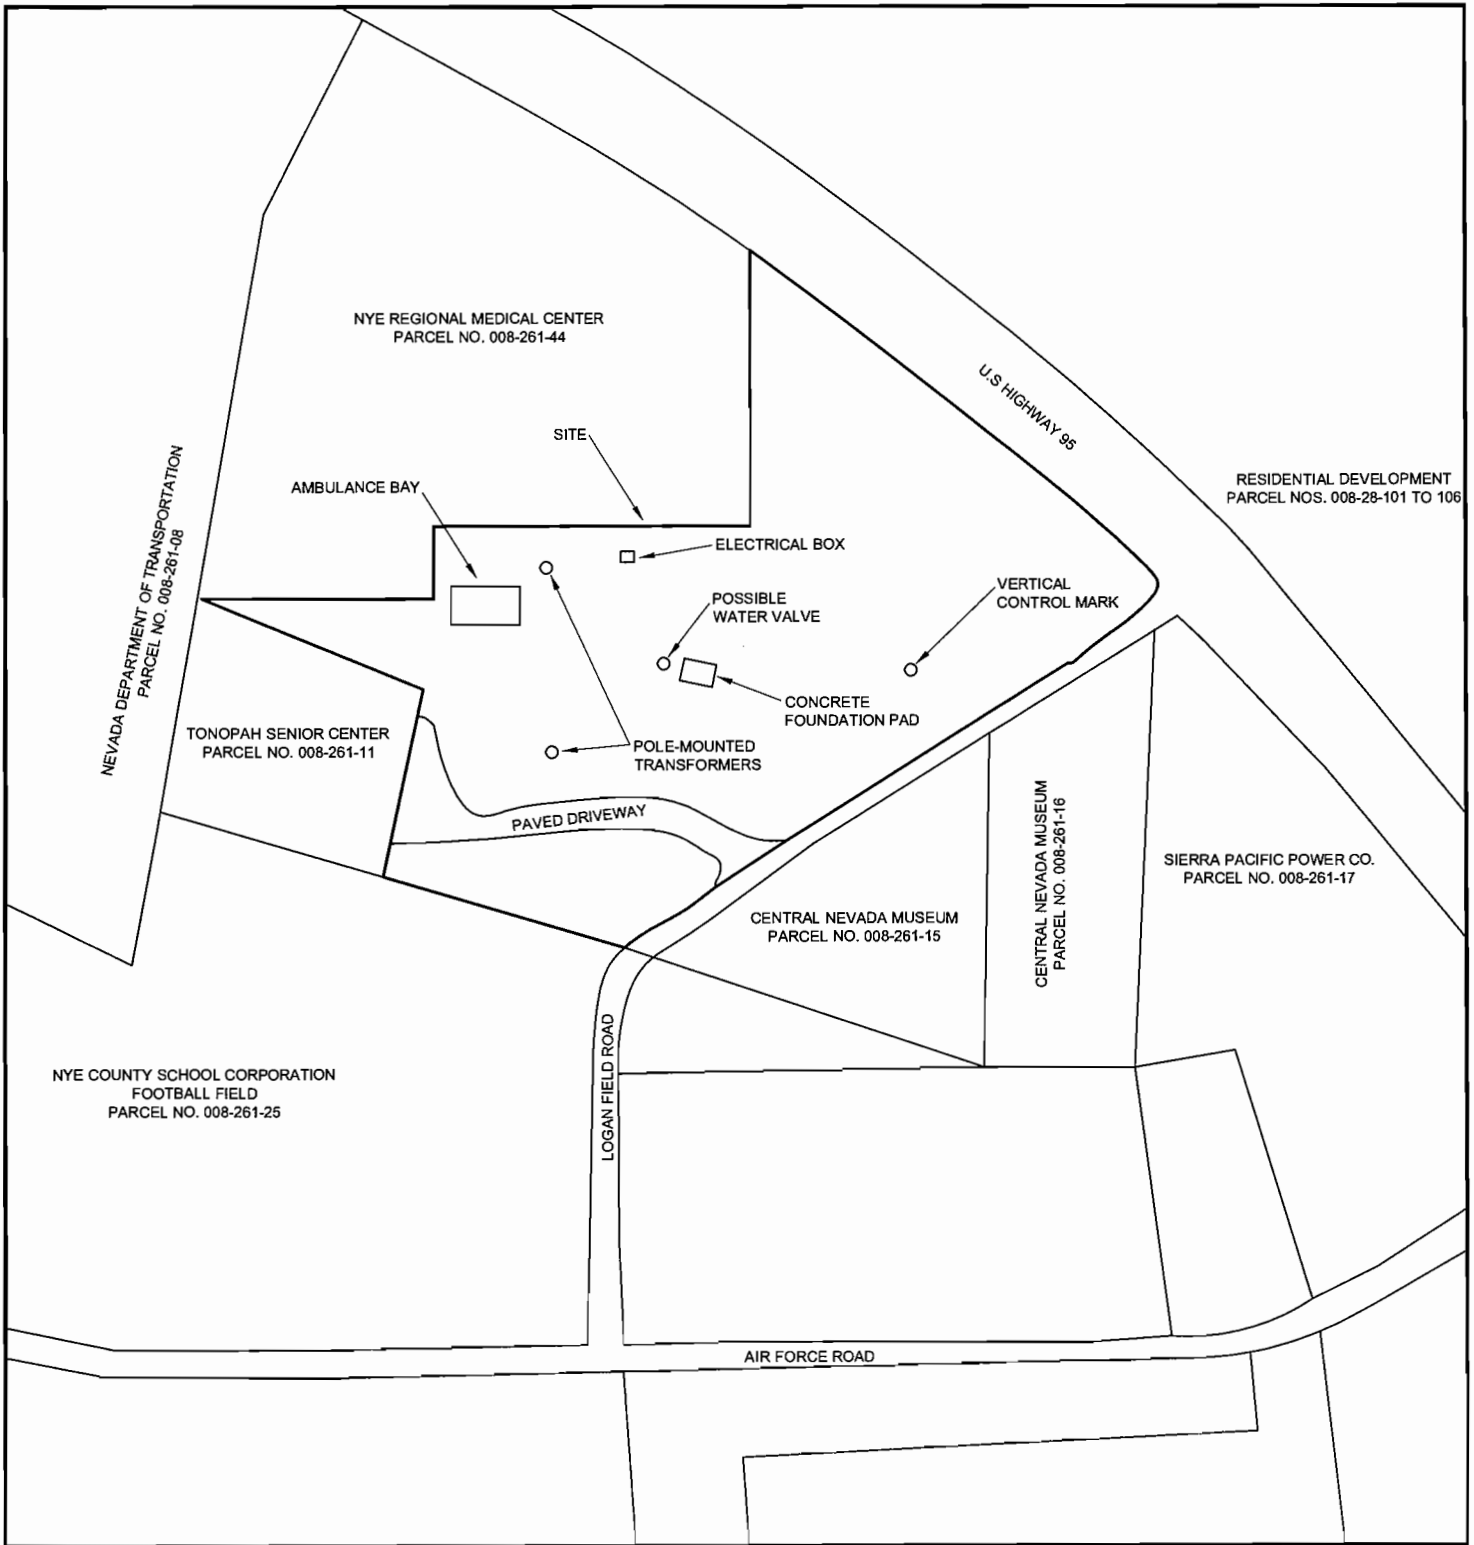

NOTE: DIMENSIONS, DIRECTIONS, AND LOCATIONS ARE APPROXIMATE.
 REFERENCE: 2009 GOOGLE EARTH

		SITE PLAN		FIGURE 2
		PHASE I ENVIRONMENTAL SITE ASSESSMENT PARCEL NO. 008-261-45 TONOPAH, NEVADA		
PROJECT NO.	DATE			
302967001	12/09			

APPENDIX A
SITE PHOTOGRAPHS

APPENDIX B

PROPERTY RECORDS DOCUMENTATION

- B-1 - Nye County Tax Assessor Records
- B-2 - Environmental Lien Search Report

APPENDIX B-1

PROPERTY RECORDS DOCUMENTATION

Nye County Tax Assessor Records



Parcel Detail for Parcel # 008-261-45

Location

Property Location F#476313 P.B1 5.5AC
 Town TONOPAH
 Subdivision Lot Block
 Property Name F#476313 P.B1 5.5AC

Description

Total Acres 5.500 Ag Acres .000 W/R Acres .000

Improvements

Single-fam Detached 0	Non-dwell Units 0	Bdrm/Bath 0/.00
Single-fam Attached 0	MH Hookups 0	Stories .0
Multi-fam Units 0	Wells 0	
Mobile Homes 0	Septic Tanks 0	
Total Dwelling Units 0	Bldg Sq Ft 2,553	
<input type="button" value="Improvement List"/>	Garage Sq Ft 0	Attch/Detch
<input type="button" value="Improvement Sketches"/>	Basement Sq Ft 0	Finished 0

Ownership

Assessed Owner Name NYE COUNTY COMMISSIONERS
 Mailing Address P O BOX 153
 TONOPAH, NV 89049-0473

Legal Owner Name NYE COUNTY COMMISSIONERS
 Vesting Doc#, Date 00/00/00 Book/Page /
 Map Document #s

Appraisal Classifications

Current Land Use Code 400

Zoning

Re-appraisal Group 5 Re-appraisal Year 2005
 Orig Constr Year 1996 Weighted Year

Valuation

	Working Year 2011-12	Closed/Reopened Year 2010-11	Prior Year 2009-10
Land	46,200	46,200	46,200
Improvements	58,349	58,349	59,238
Personal Property	0	0	0
Ag Land	0	0	0
Exemptions	104,549	104,549	105,438
Net Assessed	0	0	0

Legal Description for Parcel # 008-261-45

Legal Description	Sect/ Lot	Town/ Block	Range	Acres
T2N R42E S1 F#476313 P.B1 5.5AC	1	2N	42E	5.500
Primary new parcel is Parcel # 008-261-44				

Improvement List for Parcel # 008-261-45								
	Grp #	Impr #	Description	Year	Cnt/Size	Replacement Cost	Assessment Date	RCNLD
Open	1	1	ASPHALT	1983	13,150	12,361	08/01/05	7,355
Open	4	1	AMBULANCE SERVICE BLDG.	1996	2,345	177,735	08/01/05	140,411
RCNLD: Replacement Cost New, Less Depreciation								
								Close Window

Additional Locations for Parcel # 008-261-45


#	Dir	Street or Other Description	Unit #(s)
		AMBULANCE BAY	

Close Window


08-26



REV. 10-29-85
04-27-88
10-14-91
09-06-94
11-16-94
12-21-94
03-30-99
10-07-99
04-15-02
10-28-08
04-14-09



T2N, R42E
POR. OF SECTIONS 1 & 2

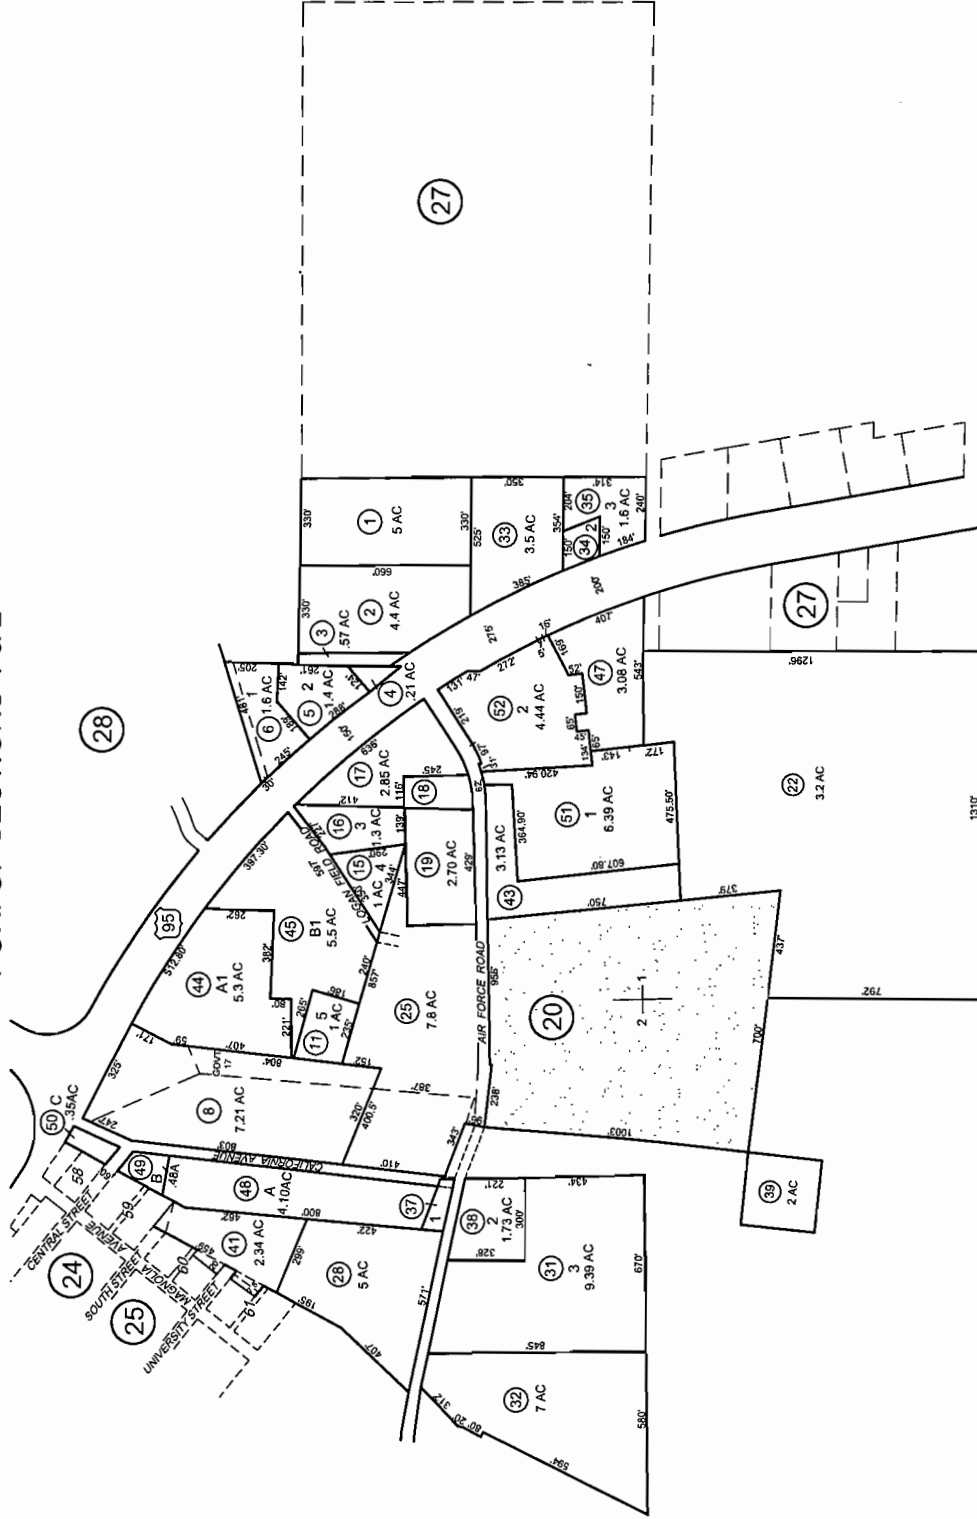

NOTE: THIS PLAT IS FOR ASSESSMENT USE ONLY AND
DOES NOT REPRESENT A SURVEY. NO LIABILITY IS
ASSUMED AS TO THE ACCURACY OF THE DATA
DELINEATED HEREON.

DEC. 82/WTB - bjb
CAD FILE 10-28-08/NG
NYE COUNTY ASSESSOR

\\fp-path\users\ngrossell\APN Books\Updates 2009.03.04 to\08-26-090414-ng.dwg, 4/14/2009 4:42:43 PM


Nye County
 NOTE: This plat is for assessment use only and does not represent a survey. No liability is assumed as to the accuracy of the data delineated hereon.

POR. T2B3N
 POR. R 42 & 43E

BOOK 08
 INDEX MAP
 1 OF 2
 2-2, 5-14-85
 5-14-86
 5-30-86
 12-3-90
 12-3-91

BK 12

BK 02

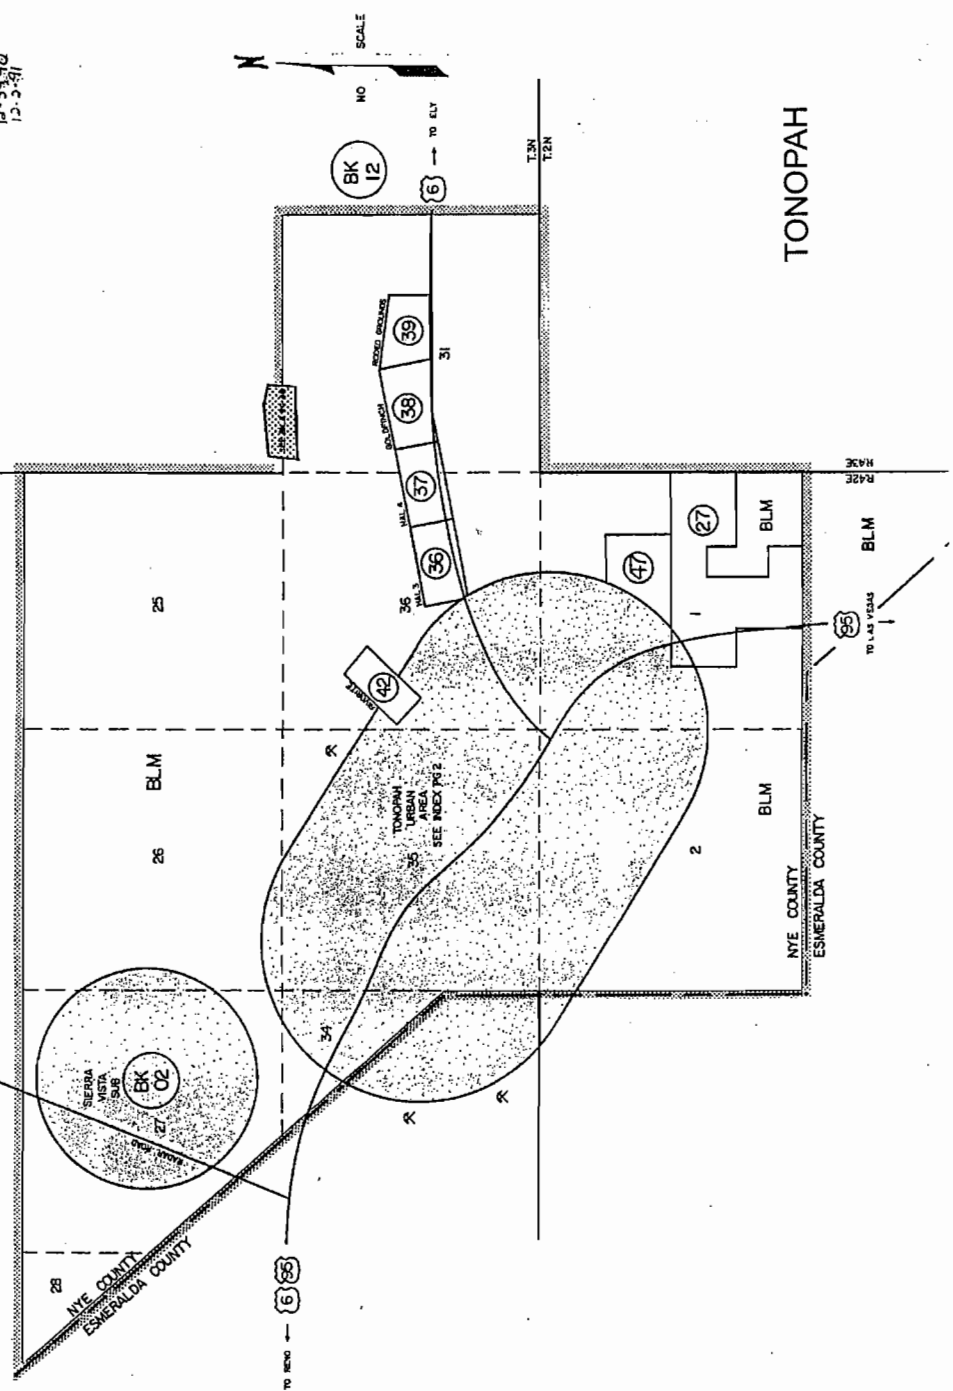

JANBY/RLW
 NYE CO. ASSESSOR

TONOPAH

APPENDIX B-2
PROPERTY RECORDS DOCUMENTATION
Environmental Lien Search Report



Environmental Lien Search

November 11, 2009

CLIENT

**Ninyo and Moore
Attn: Ryan Jones
6700 Paradise Road, Suite E
Las Vegas, Nevada 89119**

SITE

**No Site Address
Tonopah, NV 89049
Nye County**

Client #: 302967001

Banks Project #: ES58859



LIEN SEARCH REPORT

PROPERTY DESCRIPTION

LEGAL DESCRIPTION: See Attached
SUBJECT PARCEL NUMBER: 008-261-45
CURRENT OWNER(S): Nye County Board of Commissioners

Lien Search Result

Researcher's Note: No vesting deed could be located into the Nye County Board of Commissioners. The density of transactions to and from this entity would require thousands of possible documents be reviewed to determine the current vesting document. Such a search would take a number of weeks and would be considered time and cost prohibitive.

No Environmental Liens on file for The Nye County Board of Commissioners. Nevada does not appear to be a Superlien State.

LIEN SEARCH REPORT

RESEARCH NOTES

Notes:

ASTM Notes: ASTM E 1527-05, on Historical Use Information requires a review of “*Reasonably Ascertainable standard historical sources.*”

“Reasonably Ascertainable means information that is publicly available, obtainable from a source with reasonable time and cost constraints, and practically reviewable.”

This task requires reviewing only as many of the standard historical sources as are necessary, and that are reasonably ascertainable and likely to be useful.

Banks Environmental Data, Inc. has determined that the ASTM E 1527-05, Section 8.3.4.4 requirements (as it pertains to methods and locations of research) have been met for the subject property searched in this report.

Environmental Liens: No environmental liens or activity/use limitations (AUL's) identified.

RESOURCES & LIMITATIONS

Banks Environmental Data, Inc. (Banks) has completed your request for an Environmental Lien Search for the above site. The information in this report has been produced from a limited search of the public land records and/or real property records of the county back to at least the mid 1980's up through the indicated date as shown on this report. This limited search includes only environmental liens and restrictions. This report is being provided for use only as a limited part of an overall Phase I Environmental Site Assessment as performed by a qualified Environmental Engineer/Consultant as specified in the ASTM Standard E 1527-05 and as specified in the Comprehensive Environmental Response, Compensation and Liabilities Act of 1980, as amended, and may not be relied upon for any other purpose.

This report is not to be considered an Abstract, a Title Commitment, Title Opinion, Title Guaranty, or a representation of the legal status of the property. The information presented is simply a report of instruments filed of record pertaining to the above property and was obtained from the county public records. No guaranty as to the integrity or correctness of said records is implied.

LIEN SEARCH REPORT

GLOSSARY

There are certain terms used in Chain of Title searches, which may require clarification. This glossary is designed to provide definitions for some of the most common terms.

1. ENVIRONMENTAL LIEN:	The Environmental Lien is a record of a document/instrument filed by the City, County, State or Federal Government that prevents the conveyance of a property because of severe environmental problems existing on the premises.
2. BREAK IN CHAIN:	<p>There may appear to be a break in the chain of title as indicated when the sequential tracing of ownership fails. An example of a break would be: <i>Smith to Jones. . . Jones to Wilson. . . White to Black</i>. The missing link is from Wilson to White. There are several possible reasons for this occurrence.</p> <ul style="list-style-type: none"> • Due to the size or other physical characteristics of the property, there could be multiple owners at any time when tracing the history of the ownership of the property. • There could be an "easement title" over some portion of the property, allowing for use of that portion for a specific purpose. • There could be a "multi-percentage interest" in the property, with concurrent multiple owners making up 100% of the fee title. Then, a percentage owner deeds out his particular interest or a percentage of this interest to one or more parties. This causes a perceived break in the chain.
3. EASEMENT:	An easement is the right to enter and use another person's property: a non-possessor right to use another person's real property. Traditionally easements are granted to utility companies and other service organizations or as a right of access to another property.
4. MULTIPLE OWNERS:	<p>When "others" or "et al" appears on the report in the owner category, it indicates multiple ownership of a single parcel, with too many names to record in summary. It is frequently used to denote more than a single owner. If the owners are a married couple, both names may appear on the report or may be denoted by "et ux".</p> <p>The term "owners" is usually used to indicate owners of multiple parcels, all recorded under a document that covers the multiple parcels.</p>
5. MULTIPLE PARCELS:	Some properties are created by combining several adjoining parcels into one large parcel. When this occurs; there might be several different owners until the time of unification of the property. Sometimes the ownership appears to be cloudy until each owner conveys his/her interest to the single owner of the new larger parcel.

DISCLAIMER

The information contained in this report has been obtained from publicly available sources and other secondary sources of information produced by entities other than Banks Environmental Data, Inc (Banks). Although great care has been taken by Banks in compiling and checking the information contained in this report to insure that it is current and accurate, Banks disclaims any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence or otherwise, and for any consequences arising therefrom. The data provided hereunder neither purports to be nor constitutes legal or medical advice. It is further understood that Banks makes no representations or warranties of any kind. Including, but not limited to, the warranties of fitness for a particular purpose of merchantability, nor any such representations or warranties to be implied with respect to the data furnished, and banks assumes no responsibility with respect to our customer's, its employees', clients', or customers' use thereof. Banks shall not be liable for any special, consequential, or exemplary damages resulting in whole or in part, from customer's use of the data. Liability on the part of Banks Environmental Data, Inc (Banks) is limited to the monetary value paid for this report. The report is valid only for the geographical parameters specified on the cover page of this report, and any alteration or deviation from this description will require a new report. This report does not constitute a legal or licensed opinion.

APPENDIX C
REGULATORY RECORDS DOCUMENTATION

APPENDIX D

HISTORICAL RESEARCH DOCUMENTATION

- D-1 - Historical Topographic Maps
- D-2 - Aerial Photograph

APPENDIX D-1

HISTORICAL RESEARCH DOCUMENTATION

Historical Topographic Maps

APPENDIX D-2
HISTORICAL RESEARCH DOCUMENTATION
Aerial Photograph

APPENDIX E

INTERVIEW DOCUMENTATION

- E-1 - Owner Interview Documentation
- E-2 - Local Governmental Officials Interview Documentation
- E-3 - Other Interview Documentation

APPENDIX E-1
INTERVIEW DOCUMENTATION
Owner Interview Documentation

PHASE I ENVIRONMENTAL SITE ASSESSMENT SITE INFORMATION QUESTIONNAIRE

Please answer the following questions in good faith and to the best of your knowledge, and provide as much detail as possible. Thank you for your assistance.

General Information	
Site Name: Parcel 008-261-45	
Street Addresses (list all addresses, current and historical): Unaddressed Parcel - Logan Field Road and Highway 95	
Assessor's Parcel Number(s): Parcel 008-261-45	
City/State/Zip: Tonopah, NV, 89049	
Site Owner: Nye County Commissioners	
Current Site Occupants (name and nature of business): Nye County Emergency Services	
Site Description	
Size of Site (acreage/square feet):	5.500 Acres
Date(s) of construction of current buildings:	Unknown
No. of Buildings/No. of Floors:	1 metal building
Square Footage of Building(s):	Unknown
Construction Type (tilt-up, wood-framed, etc.):	Metal building
Current Site Use(s)/Dates of Operation:	Nye County Emergency Services
Type of heating/cooling system(s): (electric, natural gas, other):	Propane (Heat)/Electric (AC)
Location of heating/cooling system (roof, boiler room, etc.):	Inside & outside
Utility Information	
Name of water supplier:	Tonopah Public Utilities
Name of electrical/natural gas utility company:	NV Energy
Name of sewer services provider:	Tonopah Public Utilities
Is site on a septic system?	None
Trash pick-up/waste management method:	Hoss Disposal
Equipment On the Site (please list number and location of current or historical features)	
Underground storage tanks?	Unknown
Aboveground storage tanks?	Unknown
Elevators/type (hydraulic, traction)?	Unknown
Hydraulic lifts?	Unknown
Electrical transformers?	Unknown

PHASE I ENVIRONMENTAL SITE ASSESSMENT SITE INFORMATION QUESTIONNAIRE

Please answer the following questions in good faith and to the best of your knowledge, and provide as much detail as possible. Thank you for your assistance.

Floor drains?	Unknown
Sumps and/or clarifiers?	Unknown
Wells (water, oil, geothermal, dry, groundwater)?	None
Pipelines crossing the site (underground or aboveground)?	None
Hazardous Building Materials	
Any asbestos-containing materials on the site?	None
Any lead-based paint on the site?	None
Hazardous Materials/Wastes	
Please describe on-site processes involving the use of chemicals. Unknown	
Are hazardous materials present on the site, including pesticides, maintenance supplies, pool chemicals? If so, please describe the materials and method of storage. Unknown	
Are hazardous wastes generated or stored on the site? If so, please describe the wastes and method of storage and disposal. Unknown	
Site History	
What is the history of the site? What activities have occurred on the site in the past (e.g., ranching, residential, auto maintenance, etc.)? Open Ground. Office & Ambulance Barn for Nye County Emergency Services	
Has the site been used for any of the following (circle or describe):	
<ul style="list-style-type: none"> • Gas Station • Automotive Repair • Dry Cleaning • Commercial printing 	<ul style="list-style-type: none"> • Photo Developing Laboratory • Agricultural (farming or ranching) • <u>Junkyard or Staging Area</u> • Landfill or Recycling Facility • Shooting range
Were any structures or features (sheds, barns, homes, etc.) located on the site in the past that have since been demolished or are no longer obvious? Unknown	
Has there been any dumping or burning of trash on the site (legally or illegally)? Unknown	
Have fill soils ever been brought to the site (e.g., to fill in a canyon, provide foundation for a structure, etc.)? Yes.	
Have any major building renovation/demolition activities been performed at the site? Unknown.	
How deep is groundwater at the site? Unknown.	


PHASE I ENVIRONMENTAL SITE ASSESSMENT SITE INFORMATION QUESTIONNAIRE

Please answer the following questions in good faith and to the best of your knowledge, and provide as much detail as possible. Thank you for your assistance.

Environmental Issues
Are you aware of any current or former environmental issues at the site or at any nearby properties (spills, cleanups, groundwater contamination, etc.)? If so, please describe. No.
Are you aware of any of the following issues associated with the site or adjacent properties (circle or describe): <ul style="list-style-type: none"> • Surface water run-on or run-off problems - No • Standing water - No • Stained soil - No • Distressed vegetation/wildlife - No • Foul odors - No
Are you aware of any contamination existing in soils or groundwater on the site, currently or in the past? No
Are you aware of any environmental cleanup liens or deed restrictions against the site that are filed or recorded under federal, tribal, state or local law? No.
Are you aware of any activity and/or land use limitations, such as engineering controls, land use restrictions, or institutional controls that are in place at the site and /or have been filed or recorded in a registry under federal, tribal, state or local law? No.
As the user of this Phase I ESA, do you have any specialized knowledge or experience related to the site or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the site or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business? (User only) Unknown.
Does the purchase price being paid for the site reasonably reflect the fair market value of the site? if you conclude that there is a difference, have you considered whether the lower purchase price is because contamination is known or believed to be present at the site? N/A
Are you aware of commonly known or reasonably ascertainable information about the site that would help the environmental professional to identify conditions indicative of releases or threatened releases? For example, as the user, <ul style="list-style-type: none"> • do you know the past uses of the site? • do you know of any specific chemicals that are present or once were present? • do you know of any spills or other chemical releases that have taken place? • do you know of any environmental cleanups that have taken place? <p style="margin-left: 20px;">Undeveloped land.</p>
As the user of this Phase I ESA, based on your knowledge and experience related to the site, are there any obvious indicators that point to the presence or likely presence of contamination at the site? (User only) No.

PHASE I ENVIRONMENTAL SITE ASSESSMENT SITE INFORMATION QUESTIONNAIRE

Please answer the following questions in good faith and to the best of your knowledge, and provide as much detail as possible. Thank you for your assistance.

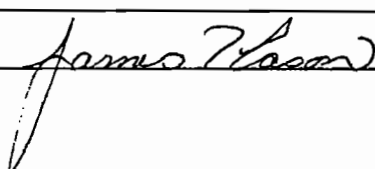Environmental Reports, Permits and Documentation		
Are there any environmental permits for equipment/activities on the site? No.		
Are you aware of any previous environmental reports or other documents that have been prepared regarding the site? No.		
What is the reason that this Phase I ESA is being conducted? Future Development		
What is the type of site transaction that will occur? (e.g., sale, purchase, refinance, exchange, etc.) Unknown		
Can you provide contact information for former owners, occupants, or managers of the site? Nye County Emergency Services.		
Can you provide copies of title reports, tax records, land title records, zoning or land use records for the site? Nye County Staff can assist.		
Who is the site contact, and how can they best be reached?		
James Eason, Town Manager 775-482-6336	BEC Environmental 702-304-9830	Nye County Staff 775-482-
Any other persons who are knowledgeable about the history or environmental status of the site? If so, please provide contact information. Nye County Emergency Services 775-482-7244		
Please inform us if there are any confidentiality concerns associated with preparation of this report. For example, would it be appropriate for us to interview neighbors, if necessary? Unknown		
Name of Individual Completing this Questionnaire: James Eason		
Title/ Company: Town Manager/Town of Tonopah		
Date Questionnaire Completed: 12/02/09		
Signature/Date: 		

APPENDIX E-2

INTERVIEW DOCUMENTATION

Local Governmental Officials Interview Documentation

Ryan Jones

Subject: APNs 008-261-18, 008-261-19, 008-261-45, 008-271-15, and 008-271-16
Entry Type: Phone call
Company: NDEP - Carson City, NV.

Start: Wed 10/28/2009 3:15 PM
End: Wed 10/28/2009 3:20 PM
Duration: 5 minutes

Spoke with Gail White (File Review Manager) regarding the subject sites. She stated that no information is available for unaddressed properties.

APPENDIX E-3
INTERVIEW DOCUMENTATION
Other Interview Documentation

Gregory Beck

Subject: Charlie Mann @ 302967001
Entry Type: Phone call
Company: Nye Regional Medical Center

Start: Thu 12/10/2009 8:25 AM
End: Thu 12/10/2009 8:28 AM
Duration: 3 minutes

775 482-6233

He is the Administrator for Nye Regional Medical Center. The ambulance bay is not part of the medical center but he is familiar with operations there. According to Mr. Mann, the building is used as a training classroom and to house ambulances. No vehicle maintenance is performed there and no hazardous materials other than possible retail-size quantities of common cleaning and lubrication materials are stored there.

RYAN C. JONES, CEM

PROJECT GEOLOGIST

EDUCATION

BS, Geology, 2003, University of Southern Indiana, Evansville, Indiana

REGISTRATIONS AND CERTIFICATIONS

CEM 2129 (Nevada)

Asbestos Abatement Consultant IM 1189 (Nevada)

AHERA-accredited Building Inspector for Asbestos

AHERA-accredited Contractor/Supervisor for Asbestos

EPA-certified Lead Inspector/Risk Assessor (Nevada)

EPA-certified Lead Inspector/Risk Assessor (Arizona)

40-Hour OSHA HAZWOPER Health and Safety Training

ACI Concrete Field Testing Technician - Grade I

NITON XRF Spectrum Analyzer

Visible Emissions Certification

Dust Monitor and Dust Control Certification

PROFESSIONAL AFFILIATIONS

Association of Environmental and Engineering Geologists

Environmental Information Association

Mr. Jones' professional experience includes performing all phases of environmental surveys of residential, commercial, and industrial properties, including the assessment, quantification, and sampling of hazardous materials such as asbestos, lead-based paint and mold; performing Phase I Environmental Site Assessments, including historical property reviews, site reconnaissance, and data compilation; conducting groundwater monitoring, well injections, and sampling; and preparing comprehensive environmental reports.

REPRESENTATIVE PROJECT EXPERIENCE

Reid Gardner Power Station, Moapa, Nevada: Project Manager during the preparation of quarterly monitoring reports for submission with a discharge monitoring report. Duties included collection of groundwater samples from over 80 monitoring wells, seven evaporation ponds, and five Muddy River samples; laboratory oversight; and preparation of written reports documenting our analysis, conclusions, and recommendations.

Floyd Lamb State Park, Las Vegas, Nevada: Project Geologist during a Phase I Environmental Site Assessment (ESA) for a 2,040-acre park. Mr. Jones' duties included reviewing federal, state, and county environmental records, historical site use documents, aerial photographs, and topographic maps; performing a site reconnaissance; and aiding in preparation of a Phase I ESA report documenting the work scope, findings, and conclusions and recommendations.

Bonneville Underpass Remediation System, Las Vegas, Nevada: Project Manager providing environmental consulting services for the Bonneville Avenue underpass remediation system located at the 600 Block of Bonneville Avenue, approximately 500 feet west of Main Street. Mr. Jones performed routine maintenance on the remediation system, conducted the quarterly groundwater monitoring and sampling, and prepared the quarterly monitoring report.

Red Rock Hotel and Casino, Las Vegas, Nevada: Project Manager during a mold remediation clearance evaluation for contaminated pool pump rooms. The affected areas were placed under negative pressure and mold-contaminated building materials were removed. Following visual inspections of the rooms, mold spore traps were used to collect air samples from discreet areas. Collected indoor air samples were compared to outdoor ambient air samples. Utilizing EPA recommended criteria, the pool pump rooms were cleared for re-occupancy.

Former 5th Street School, Las Vegas, Nevada: Asbestos/Lead Inspector during an asbestos and lead-based paint survey of six buildings for the purpose of renovation and demolition. Mr. Jones' duties included following AHERA and HUD guidelines for the collection of asbestos bulk samples and XRF/paint chip samples in each building, visual assessment of surfaces, data interpretation, and aiding in preparation of a comprehensive written report.

Bellagio Hotel and Casino, Aquifer Pumping Test, Las Vegas, Nevada: Staff Geologist for an aquifer pumping test performed for a new employee parking garage located at the Bellagio Hotel and Casino. Mr. Jones observed the installation a pumping well and four water monitoring wells, logged soil characteristics during drilling, conducted soil and water testing, and prepared a comprehensive written report. The results were used to plan appropriate disposal procedures for the soil cuttings generated during well installation and the groundwater generated during the aquifer pumping test.

Ninyo & Moore

Experience | Quality | Commitment

REPRESENTATIVE PROJECT EXPERIENCE (continued)

New Economy Lot, McCarran International Airport, Clark County, Nevada: Project Manager during preparation of a site-specific Health and Safety Plan (HASP) and an Environmental Management Plan (EMP) for an 11-parcel, 44.3-acre site formerly used for rental car facilities at the McCarran International Airport. Mr. Jones' duties included providing health and safety oversight of the contractor and monitoring compliance with the approved HASP; performing sampling and analysis of suspected contaminated soil encountered during construction activities; and managing segregation and disposal of excavated contaminated soil.

City Center Resort, Las Vegas, Nevada: Staff Geologist for aquifer pumping tests and a soil and groundwater sampling assessment for the City Center Resort located on the Bellagio property at 3600 Las Vegas Boulevard South. Duties included observing the installation of five observation wells and 20 pumping wells, collecting groundwater samples for laboratory analysis of volatile organic compounds, and collecting soil samples for analysis of extractable total petroleum hydrocarbons and metals, including arsenic, barium, cadmium, chromium, lead, mercury, selenium, and silver. Mr. Jones also prepared a final report including laboratory results, boring logs, figures, and conclusions and recommendations.

Gateway Remediation System, Las Vegas, Nevada: Senior Staff Geologist for this groundwater remedial action of a former gasoline station site. This major street improvement project had petroleum hydrocarbon contamination in the soil and groundwater in the proposed roadway realignment. Ninyo & Moore was contracted by the City of Las Vegas to remediate the site while maintaining traffic and pedestrian flow. Mr. Jones performed routine maintenance on the remediation system, injected hydrogen peroxide solution into selected monitoring wells, conducted the quarterly groundwater monitoring and sampling, and prepared the quarterly monitoring report.

Reid Gardner Power Station, Moapa, Nevada: Project Manager during the preparation of quarterly monitoring reports for submission with a discharge monitoring report. Duties included collection of groundwater samples from over 80 monitoring wells, seven evaporation ponds, and five Muddy River samples, oversight of laboratory, and preparation of written reports including documentation to support our analysis, conclusions, and recommendations.

Caesar's Hotel and Casino, Former Dry Cleaning Facility Remediation, Las Vegas, Nevada: Staff Geologist for the remediation of a former dry cleaner located in the basement of Caesar's Hotel and Casino. Mr. Jones observed the removal of a sanitary sewer drainpipe contaminated with tetrachloroethene (PCE); sampled associated soil and wastewater to assess the extent of contamination; and disposed of the sanitary sewer drainpipe and associated concrete floor slabs, floor drains, and wastewater appropriately. Mr. Jones's duties also included the preparation of a comprehensive written report.

Rebel Oil, Las Vegas, Nevada: Senior Staff Geologist for this former gasoline station remediation project, which included quarterly groundwater monitoring and injection of hydrogen peroxide into groundwater monitoring wells. Duties included collection of samples of groundwater, injection of hydrogen peroxide solution into selected monitoring wells, compilation of quarterly groundwater monitoring data into a database and quarterly monitoring report, design and oversight of remedial action, coordination of system and well abandonment, and coordination of contractors and project staff.

GREGORY A. BECK, CEM

CHIEF ENVIRONMENTAL SCIENTIST

EDUCATION

MBA, 1990, University of North Florida,
Jacksonville, Florida

MS, Biology, 1982, Florida Institute of
Technology, Melbourne, Florida

BS, Biology, 1979, Florida Institute of
Technology, Melbourne, Florida

REGISTRATIONS AND CERTIFICATIONS

CEM 1874 (Nevada)

40-Hour OSHA HAZWOPER Health and
Safety Training

Mr. Beck's professional experience includes acquisition, documentation and dissemination of data related to all phases of environmental investigations and projects. These activities include performance of a site reconnaissance, oversight of drilling activities, logging of subsurface geologic conditions, soil and groundwater sampling, and monitoring well installation, including development, purging, and monitoring. Mr. Beck also analyzes field, laboratory, and office data; and coordinates project-related work of staff personnel.

REPRESENTATIVE PROJECT EXPERIENCE

Brownfields Assessment Grant Administration, North Las Vegas, Nevada: Project Manager during administration of a Brownfields Community-Wide Petroleum Assessment grant for the City of North Las Vegas. Mr. Beck's duties included implementing the administrative and programmatic conditions of the Cooperative Agreement establishing the grant conditions, including preparation and submission of quarterly progress reports and MBE/WBE Utilization Reports, management of Phase I and II Environmental Site Assessments (ESAs), submission of Phase I and II assessment reports, and coordinating closeout activities, including preparation of a Final Summary Report upon expiration of the grant.

Cornerstone Redevelopment Area, Henderson, Nevada: Project Manager for this Nevada Division of Environmental Protection (NDEP) Brownfields project involving preparation of a Phase I Environmental Site Assessment (ESA); submission of a Sampling and Analysis Plan (SAP) to the USEPA Region 9 for approval; performance of a Phase II ESA which included installation of groundwater monitoring wells; sampling and analysis of soil, groundwater, and surface water; and preparation of a report. Mr. Beck coordinated with state and local officials; provided supervision over field personnel and subcontractors to assure that activities conformed to the approved Sampling and Analysis Plan; prepared project reports and other documents; reviewed extensive regulatory files to determine the likely sources and extent of this contamination; and tracked project expenditures to assure that the budget was not exceeded.

Supplemental Environmental Impact Statement, Clark County, Nevada: Project Manager for preparation of the Hazardous Materials and Geologic Hazards sections of the SEIS. Mr. Beck reviewed state and federal regulations, geologic maps and literature; drafted new Hazardous Materials sections for the SEIS; and coordinated updating of the Geologic Hazards sections of the existing EIS.

Apex Mine Processing Facility, St. George, Utah: Project Manager for the oversight of decommissioning activities for a former manganese and tungsten processing facility outside St. George, Utah. Mr. Beck reviewed closure plans; reviewed laboratory analytical data; attended progress meetings; briefed the Bureau of Indian Affairs and the Shivwits Band of the Paiute Indian Tribe; and prepared response documents.

Beatty Habitat Trails, Nye County, Nevada: Project Manager during a Phase I ESA and mine audit survey of 7,230 acres of Bureau of Land Management land designated for inclusion in the Beatty Habitat Trails system. Mr. Beck performed a field survey of the designated acreage, including a field survey of abandoned mines and prospect holes located within 1/8-mile of the acreage; reviewed various historical databases, including aerial photographs; performed a database search of state and federal regulatory databases; and prepared various summary reports.

REPRESENTATIVE PROJECT EXPERIENCE (continued)

Gowan Outfall, Lone Mountain Branch, North Las Vegas, Nevada: Technical Reviewer for a Phase I Environmental Site Assessment (ESA) and Section 8 Environmental Analysis of 2 miles of reinforced concrete box flood control structure along Lone Mountain Road in North Las Vegas, Nevada. Mr. Beck provided technical support to the Project Manager; and reviewed Phase I ESA and Section 8 Environmental Analysis reports.

Tonopah Airport, Tonopah, Nevada: Project Manager for this state Brownfields financed project involving preparation of a Phase I Environmental Site Assessments (ESA) of the Tonopah Airport, formerly known as the Tonopah Army Air Force base, located on US Highway 6, 7 miles east of Tonopah, Nevada. The Phase I ESA identified recognized environmental conditions relating to leaking tanks and fuel product lines, spilled chemicals, and spilled petroleum products from maintenance facilities. Mr. Beck prepared a Sampling and Analysis Plan for the Phase II ESA to address these conditions, including installation of 26 soil borings in six general sampling areas and laboratory analysis of soil samples; and prepared a Phase II summary report.

Wetlands Park and Flamingo Arroyo Trail, Clark County, Nevada: Technical Advisor for 14 Phase I ESA of 27 parcels of undeveloped land comprising approximately 100 acres located adjacent to the Las Vegas and Flamingo Washes in Clark County, Nevada. The Phase I ESAs are part of the land acquisition process by Clark County Public Works for the proposed improvements at the Wetlands Park and the Flamingo Arroyo Trail. Duties included services as client liaison; providing technical support to the Project Manager; and reviewing the final reports.

1600, 1630, and 1736 North Las Vegas Boulevard, North Las Vegas, Nevada: Project Manager for a Phase I ESA and a Phase II ESA of four parcels totaling approximately 24 acres in North Las Vegas, Nevada. The Phase I and II ESAs were performed under Community-Wide Brownfields petroleum and hazardous substances assessment grants, respectively awarded to the City of North Las Vegas by the United States Environmental Protection Agency (EPA). Mr. Beck's duties included reviewing federal, state, and county environmental records, historical site use documents, aerial photographs, and topographic maps; coordinating a site reconnaissance, fieldwork, and installation of groundwater monitoring wells; preparing a Sampling and Analysis Plan; and preparing Phase I and Phase II ESA reports documenting the work scope, findings, and conclusions and recommendations.

15 West Owens Avenue, Las Vegas, Nevada: Project Manager during a Phase I ESA for a 4.86-acre parcel. Mr. Beck's duties included reviewing federal, state, and county environmental records, historical site use documents, aerial photographs, and topographic maps; coordinating a site reconnaissance; and preparing a Phase I ESA report documenting the work scope, findings, and conclusions and recommendations.

1510 North Decatur Boulevard, Las Vegas, Nevada: Project Manager during a Phase I ESA for a 7.89-acre parcel. Mr. Beck's duties included reviewing federal, state, and county environmental records, historical site use documents, aerial photographs, and topographic maps; coordinating a site reconnaissance; and preparing a Phase I ESA report documenting the work scope, findings, and conclusions and recommendations.

Gowan Outfall, Lone Mountain Branch, North Las Vegas, Nevada: Technical Reviewer for this Phase I ESA and Section 8 Environmental Analysis of approximately 2 miles of planned reinforced concrete box flood control structure along Lone Mountain Road in North Las Vegas, Nevada. Duties included providing technical support to the Project Manager and reviewing Phase I ESA and Section 8 Environmental Analysis reports.

Lamb Boulevard Improvements, Interstate 15 to Clark County 215, North Las Vegas, Nevada: Technical reviewer for a Phase I ESA and Section 14 Analysis of a flood control channel alignment comprised of two sections totaling 1.5 miles along Lamb Boulevard in North Las Vegas, Nevada. Duties included supervision and oversight of the review of historical records and regulatory files, performance of a site reconnaissance and interviews with site owners and/or operators to identify evidence of releases of petroleum or hazardous materials on or in the vicinity of the site, and preparation of a Phase I Environmental Site Assessment Report. For the Section 14 Analysis, duties included supervision and oversight of the review of the project impact on groundwater, land use, and recreation visual resources, socioeconomics, environmental justice, cultural resources, paleontologic resources, air quality, geology and soils, surface water, and terrestrial and aquatic biological resources.